


6. WIRING DIAGRAM

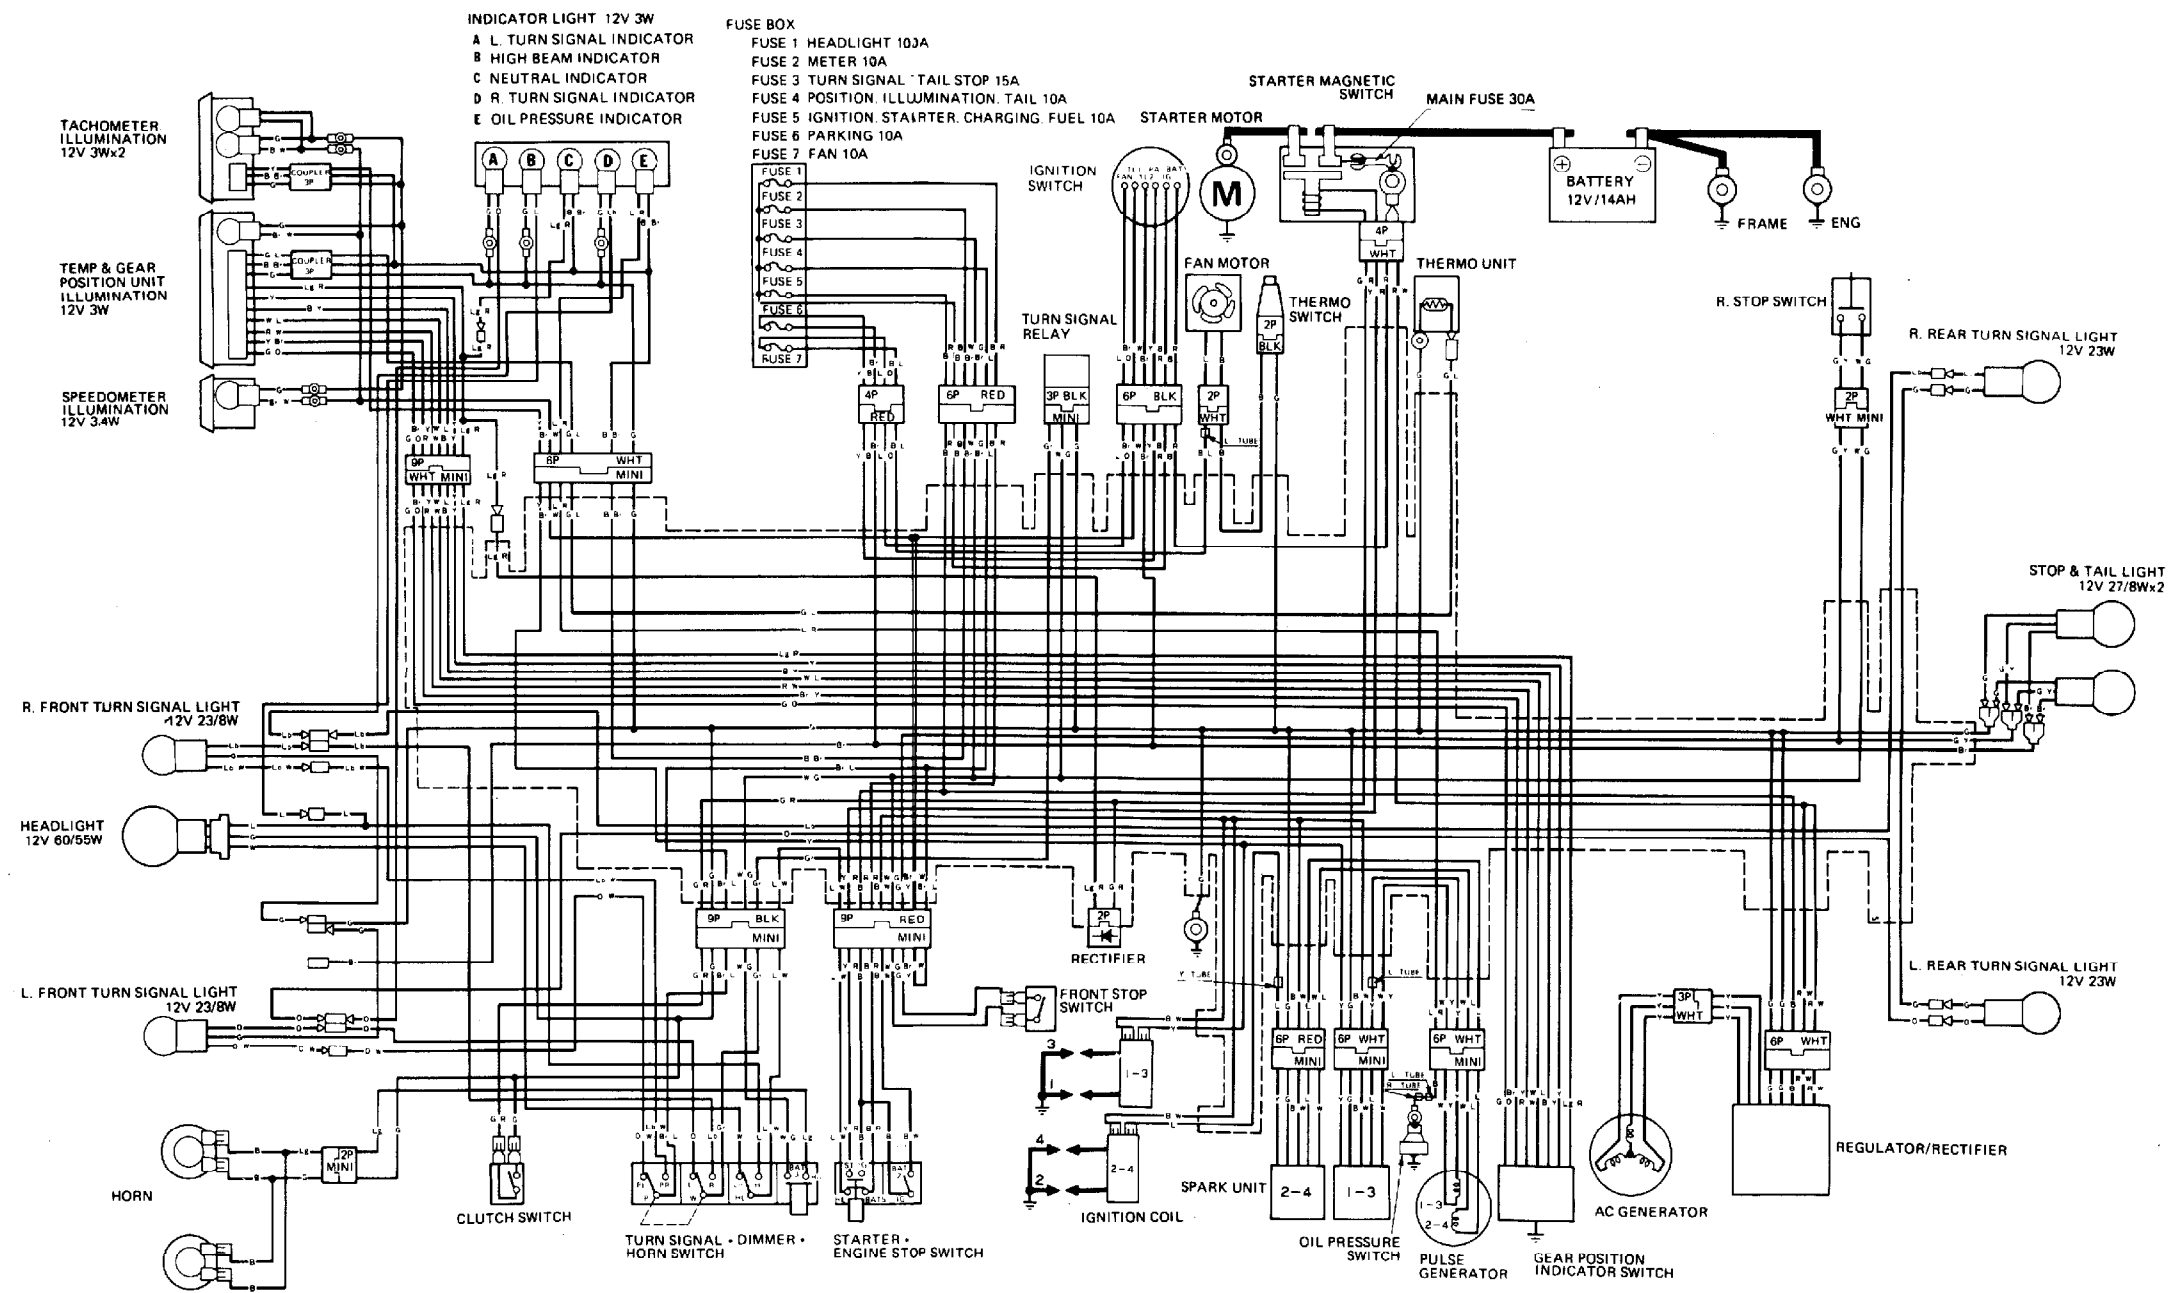

INDICATOR LIGHT 12V 3W
 A L. TURN SIGNAL INDICATOR
 B HIGH BEAM INDICATOR
 C NEUTRAL INDICATOR
 D R. TURN SIGNAL INDICATOR
 E OIL PRESSURE INDICATOR

FUSE BOX
 FUSE 1 HEADLIGHT 10JA
 FUSE 2 METER 10A
 FUSE 3 TURN SIGNAL - TAIL STOP 15A
 FUSE 4 POSITION ILLUMINATION, TAIL 10A
 FUSE 5 IGNITION, STARTER, CHARGING, FUEL 10A
 FUSE 6 PARKING 10A
 FUSE 7 FAN 10A

TACHOMETER ILLUMINATION 12V 3Wx2
 TEMP & GEAR POSITION UNIT ILLUMINATION 12V 3W
 SPEEDOMETER ILLUMINATION 12V 3.4W

R. FRONT TURN SIGNAL LIGHT 12V 23/8W
 HEADLIGHT 12V 60/55W
 L. FRONT TURN SIGNAL LIGHT 12V 23/8W

R. STOP SWITCH
 R. REAR TURN SIGNAL LIGHT 12V 23W
 STOP & TAIL LIGHT 12V 27/8Wx2
 L. REAR TURN SIGNAL LIGHT 12V 23W

IGNITION SWITCH					
BAT 1	IG	FAN	TL1	TL2	PA
OFF	○	○	○	○	○
ON	○	○	○	○	○
P	○	○	○	○	○

TURN SIGNAL SWITCH			DIMMER SWITCH			HORN SWITCH				
W	R	L	P	PR	PL	HL	Lo	Hi	Hg	BAT 3
R	○	○	○	○	○	Lo	○	○	FREE	○
N	○	○	○	○	○	(N)	○	○	PUSH	○
L	○	○	○	○	○	Hi	○	○		○

ENGINE STOP SWITCH		STARTER SWITCH		
BAT 2	IG	ST	BAT 2	BAT 5
RUN	○	FREE	○	○
OFF	○	PUSH	○	○

B	BLACK	Br	BROWN
Y	YELLOW	O	ORANGE
L	BLUE	Lb	LIGHT BLUE
G	GREEN	Lg	LIGHT GREEN
R	RED	P	PINK
W	WHITE	Gr	GRAY

0030Z-MB0-9100